Japanese Utility Model Laid-Open (JP-U) No.56-95983


(Rolling Wheel for Preventing Run-off in a Crawler-type Traveling Work Machine)

Specific examples of the device are explained in detail below. The rolling wheel 7 is structured so as to be able to oscillate around the axis of the rolling wheel axis 9. A spherical-surfaced bearing 11 may be used as one example of the oscillating mechanism. Namely, the rolling wheel axis 9 connecting the two dish members 7' and 7" of the rolling wheel 7 is supported at the spherical-surfaced bearing 11 between the rolling wheel axis 9 and a fixed housing 12, which is linked from the support cylinder 6. Further, since this portion is prone to becoming soiled with dirt and the like, it is tightly sealed with suitable seal members 13. Further, an axis member 14 is passed through the hole in the support cylinder 6 and the fixed housing 12 is fixed to a mounting element 15 that extends from the axis member 14, by a securing element 16. Further, it is possible to make the axis member 14 slidable with respect to the hole in the support cylinder 6 by providing a stopper 17 and, in this case, the rolling wheel 7 can oscillate vertically and slide horizontally which is effective in preventing run-off. Further, there are cases in which the mounting element 15 is directly fixed to the support cylinder 6.

The oscillating mechanism of the rolling wheel is not limited to the above and, for example, a sliding bearing is also conceivable. What matters is that a certain amount of vertical and horizontal oscillation is enabled while free rotation of the rolling wheel is secured.

With a rolling wheel 7 structured thus, even when the crawler 5 experiences significant partial (middle portion) warping due to sudden irregularities in terrain, rocks or suchlike and changes position, the rolling wheel easily follows the crawler 5 because it can oscillate around its axis and run-off does not occur. Namely, the rolling wheel 7 is displaced by vertical direction oscillation in response to displacement in a vertical direction of the crawler 5, and even when the crawler 5 is displaced in an horizontal direction due to turning or the like, the rolling wheel is displaced by horizontal oscillation, and can easily follow the crawler 5. Accordingly, and in combination with the favorable regulatory function of the projecting portions 5', 5', there is no run-off. The fact that there is no run-off also means that there is no damage to the core bar 8 or the crawler 5 due to the shock of run-off. Further, since the rolling wheel 7 is always located at a center section of the crawler 5, the load across the entire width of the crawler 5 is dispersed equally, which reduces the load per unit ground contact area and thus performs the intended role of a crawler belt. In addition, since the rolling wheel 7 rolls at an appropriate position of the crawler 5, undesirable noise and vibration is reduced, operational efficiency is raised, and the operational life of the machine is lengthened.

公開実用 昭和56-95983

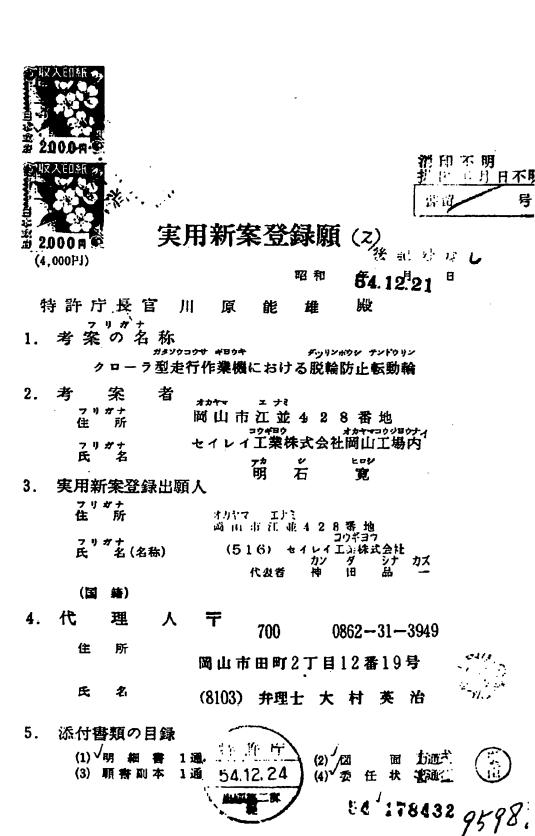

号

1.考案の名称

クローラ型走行作業機における脱輪防止転動輪 2. 実用新案登録請求の範囲

- (1) 走行部に駆動輪および受動輪を軸支して、 両者にクローラを掛張するとともに、中間に 適宜転動輪を設けて支持する走行作業機にお いて、この転動輪を少くとも軸心回りに揺動 自在としたことを特徴とするクローラ型走行 作業機における脱輪防止転動輪。
- (2) 転動輪をその軸心回りに揺動自在とするにおいて、固定するハウジングとの間で球面軸受により支承したことを特徴とする実用新案登録請求の範囲第1項記載のクローラ型走行作業機における脱輪防止転動輪。
- 3.考案の詳細な説明

この考案はクローラ型走行作業機における脱輪防止転動輪に関するものである。

車軸間隔の長いクローラ型走行作業機においては、クローラのたるみおよび脱輪防止、さらには

(1)

95983

公開実用 昭和56— 95983

機体重量支持のために駆動輪と受動輪の中間にいくつかの転動輪を設ける。

しかし地形の形状によってはクローラが著しく 傾き、また位置を変えるためにしばしば脱輪していたものであった。特に農用作業機等に装備されるゴム製のクローラは地形の形状に応じて容易に変形、変位することから一層の脱輪事態を生じていたものである。

すなわち従来多くの機種に採用されているクローラ型走行作業機の走行部は以下のような構造を 採っていた。

っても支持する。

なお駆動輪 2 は外周の鎖歯 2 がクローラ 5 に設けられたそのピッチと対応する穴等に嵌入された W動力を伝え、脱輪も防ぐ。さらに受動輪 4 おおび 転動輪 7 はそれぞれ二個の椀体 7′、 7″を背中合せにしたような形状をしており、間に設けられた 横にクローラ 5 の内周面に形成された突起部 5′)を嵌入せしめて脱輪を防いている。

その他クローラ 5 の内部には帯状の心金 8 が封入されて補強機能を果し、また転動輪 7 は転動輪軸 9 との間で軸受 1 0 によって支持され、かつ転動輪軸 9 は前記支持筒 6 の直角方向に形成された穴に嵌入して支持されている。

しかしこのような構成では、クローラ 5 が地形 形状によって大きく傾いた場合に、転動輪 7 がそ れに追従できなくて、ついには外れ走行不能や破 損を招いていたのは前記のとおりである。

そこでこの考案は少なくとも転動輪?をその軸 心回りに揺動自在とすることで、上記欠点を解消 したものである。

公開実用 昭和56-95983

以下この考案の具体例を詳説すると、転動輪で は転動輪軸9の軸心回りに揺動可能な構成とされ るものである。全の揺動機構の一例として球面軸 受11を使用したものでもよい。をすなわち転動輪 7の二個の掩体で、でを連係する転動輪軸9を、 前記支持筒 6 から連結される固定ハウジング 1 2 との間で球面軸受11で支持するものである。な おこの部分は塵芥等の多い部分であるため適宜シ ール体13等により密封する。/さらに固定ハウジ ング12は支持筒6の前記穴に軸体14を挿通さ せ、これから延伸させた取付具15に締着具16 等によって固滑する。をらに軸体14を支持簡6 の穴に対して適宜ストッパー17を設けて摺動自 在とすることもでき、この場合転動輪7は上下揺 動自在かつ水平揺動自在となり脱輪防止により有 効である。また前記取付貝15は支持簡8に直接 固剤する場合もある。✓

転動輪 7 の揺動機構としては以上に限定される ものではなく、例えば他にもすべり軸受等も考え られ、要は転動輪 7 の自由な回転を確保しつつ若 干軸心回り上下左右揺動できるものであればよい。

このような構成からなる転動輪7は、まずクロ ー ラ 5 が 突 然 の 地 形 の 凹 凸 、 あ る い は 石 等 に よっ て大きく部分的(中間部分)に傾いたり、位置を 変えた場合であっても、転動輪1はその軸心同り に揺動自在であるから、容易にクローラ5に追従 して脱輪することはない。/すなわちクローラ5の 上下方向の変位に対しては転動輪7も上下方向に 揺動変位し、またクローラ5が曲行等による水平 方向に変位したとしても転動輪 7 は水平方向に揺 動変位して容易に追従することができるから $_{\gamma}$ 起部 5、5の良好な規制作用と相まって脱輪する ことはない。反面脱輪がないということは脱輪の ショックによる心金8、クローラ5等の損傷がな いということも意味する。/また転動輪7は常にク ローラ 5 の中心部分に存在するから、クローラ 5 の幅全巾に荷重が均等に分散され、単位接地面積 当りの荷重を少くして覆帯本来の役割を果す。 らにクローラ5の適正な位置で転動輪7が転動す

公開実用 昭和56— 95983

るから、不快な騒音や振動がなくなり作業能率を 高め機械寿命も長持ちさせる。

4.図面の簡単な説明

第1図は従来構造に係る走行部の側面図、第2 図は同じく断面正面図、第3図はこの考案に係る 転動輪を使用した走行部の断面正面図、第4図は 同じく側面図である。

> 出願人 セイレイ工業株式会社 代理人 大 村 英 治


符号

2 壓動輪

4 受動輪

7 転動輪

11.... 珠面軸受

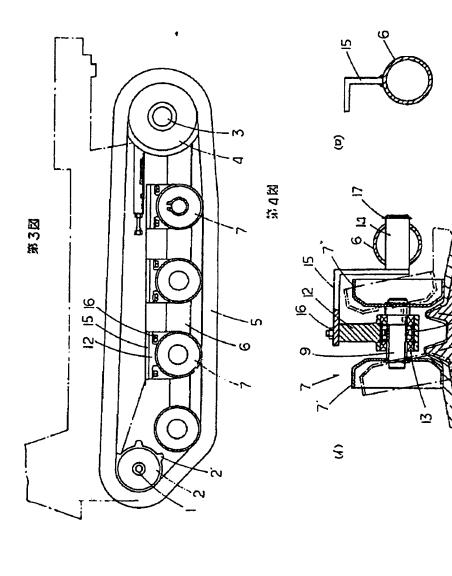


実用解案は毎川町! えんんだ様式を対 表出解案なは旧額人代明人 人日英語

63

. ဂ

※

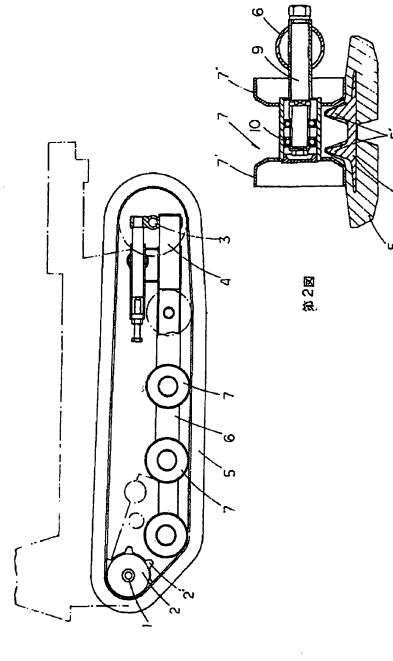

发用新家食品用牌人 人名马耳莱林 武会社 美用新家食品用圈人代理人 人名英语

95983

This Page is Inserted by IFW Indexing and Scanning Operations and is not part of the Official Record

BEST AVAILABLE IMAGES

Defective images within this document are accurate representations of the original documents submitted by the applicant.

Defects in the images include but are not limited to the items checked:

☐ BLACK BORDERS
☐ IMAGE CUT OFF AT TOP, BOTTOM OR SIDES
☐ FADED TEXT OR DRAWING
☑ BLURRED OR ILLEGIBLE TEXT OR DRAWING
☐ SKEWED/SLANTED IMAGES
☐ COLOR OR BLACK AND WHITE PHOTOGRAPHS
☐ GRAY SCALE DOCUMENTS
☐ LINES OR MARKS ON ORIGINAL DOCUMENT
☐ REFERENCE(S) OR EXHIBIT(S) SUBMITTED ARE POOR QUALITY
□ OTHER:

IMAGES ARE BEST AVAILABLE COPY.

As rescanning these documents will not correct the image problems checked, please do not report these problems to the IFW Image Problem Mailbox.